

Modello
ModelData
DateArea
Area

10

Tutti i modelli - All Models

N. Progressivo
Progressive no.

953

Subject.: UFI oil filter, part. no. 191993

With reference to our Technical Information no. 925 dated April 2001, as well as to the following information sent by fax on 26th April 2001 and 22nd May 2001 - same subject - we would like to inform you that our supplier "UFI" has produced a new oil filter, which is identified as part no. 191993: this replaces the previous part no. 111782.

The oil filter, part no. 111782 (Fig. 1) can cause oil leaks from the round-shaped seal ring fitted on circulating cars.

This oil filter features a "welded" (not riveted) plate and was produced starting from 31st May 2000.

N.B.: the oil filter manufacturing date is indicated on the upper part of the filter itself (Fig. 2).

To prevent this potential problem, our supplier UFI has produced a new oil filter, part no. 191993 (Fig. 3), maintaining the manufacturing specifications of the riveted plate and fitting a new square-section seal, in the place of the round-shaped one.

Considering the potential problem, we have decided to recall all vehicles equipped with the oil filter part no. 111782, whose plate is welded and which can be easily identified through the manufacturing date - that can be either 31st May 2000 or a subsequent date - shown on the upper part of the filter itself. The old part must be replaced with the new oil filter, part no. 191993.

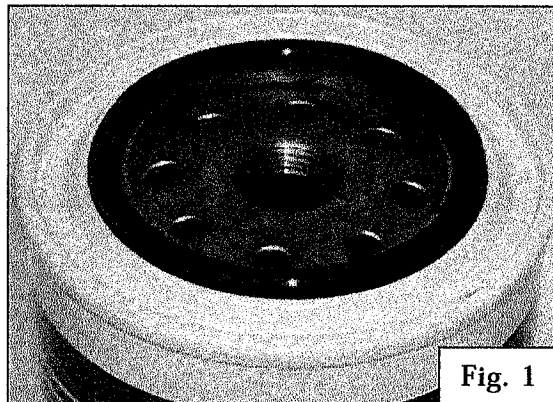


Fig. 1

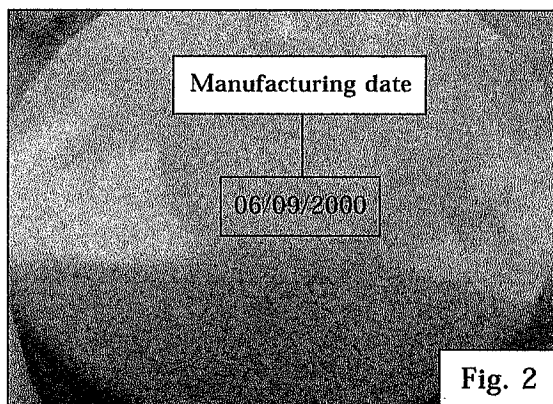


Fig. 2

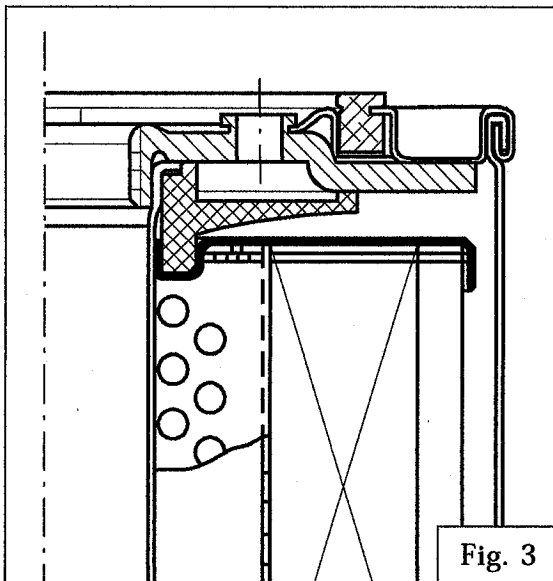


Fig. 3